

 MODEL 1750B DUAL TRACE AMPLIFIER
Serials Below 435-00176

Increased Frequency Response

Increased high frequency response on the 5, 10, and 20 volt ranges can be obtained in the above instruments by changing the resistors indicated below:

Modification Procedure

Replace resistors R105 and R205 (0683-1005) with resistors R105 and R205 (0683-1805) 18 ohm 5% 1/4 watt.

Recalibration of the 5, 10, and 20 volt ranges will be necessary. See Paragraphs 5-20 thru 5-26 of your Operating and Service Manual.

Change the Replaceable Parts List and the schematic diagrams in your 1750B Operating and Service Manual to incorporate the above changes.