

S E R V I C E N O T E

SUPERSEDES: NONE

34970A Data Acquisition/Switch Unit

Serial Numbers: 0000A00000 / US37038920

Incorrect Temperature Measurements while doing a digital READ/WRITE**To Be Performed By:** Agilent-Qualified Personnel or Customer**Parts Required:**

Reference	Part Number	Description	Quantity
U401	34970-88891	Rev 11 ROM	1

Situation:

The instrument will make incorrect temperature measurements while doing a digital READ/WRITE with the 34907A module. The cause is a defect in the 34970A firmware revision 01-xx-xx to 09-xx-xx.

34970A configuration for defect:

*34901A, 34902A, or 34908A - setup for thermocouple (type K,N,R, S,T,B,E) temperature measurements

*34907A - utilizing digital I/O port for digital reads or writes Correct measurements can be made when the default thermocouple, type J, is used.

Continued

DATE: December 2000

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
MODIFICATION RECOMMENDED					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR 1.0 Hours		
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: December 2005		
AUTHOR: DAA	ENTITY: 0940		ADDITIONAL INFORMATION:		



Solution / Action:

1.) Determine the firmware revision the customer has. This information can be obtained by pressing the following key sequence on the front panel:

- Shift

- Advanced (To get to the utility menu)

- Cycle through the utility menu until the revision code appears on the display

2.) This problem is limited to HP 34970A units with revision code 01-xx-xx through 09-xx-xx.

If the unit has any of the above revision's replace the firmware, ROM (U401), with new version (34970-88891). To verify correct installation of the new ROM, perform the complete self test, verify the time/date, and check the firmware version.

Self Test: Hold down the shift key until you hear a long beep while turning on the unit, this key sequence will initiate the self test.

Time/Date: From front panel press:

- Shift

- Advanced (To get to the utility menu), Time is displayed

- Advanced, Date is displayed

Firmware Version: Instructions to display firmware version in 1.) Make sure firmware displayed is 11-XX-XX.

The installation of the new ROM does not require the unit to be re-calibrated.