

## S E R V I C E N O T E

SUPERSEDES: 3708A-09A

**3708A Noise and Interference Test Set**

Serial Numbers: 0000U00000/2515U00778

**PROM Retrofit Kit to be used as a Preferred Replacement for PROM Failures****To Be Performed By:** Agilent-Qualified Personnel**Parts Required**

<b>P/N</b>	<b>Description</b>
03708-60006	PROM Retrofit Kit

**Situation**

In the event of a replacement being required for any of the PROMs (see Table 1) from firmware revisions 2506, 2510 and 2610, then they should be replaced with retrofit kit part number 03708-60006. The PROMs to be replaced on failure are:

Revision	A201U5	A201U6	A201U7	A201U8
2506	03708-80034	03708-80033	03708-80032	03708-80031
2510	03708-80044	03708-80043	03708-80042	03708-80041
2610	03708-80052	03708-80051		

*Continued*

DATE: October 1999

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
<b>MODIFICATION RECOMMENDED</b>			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours	
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY: <input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEETEXT	USED PARTS: <input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEETEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		
AUTHOR: PC	ENTITY: E610	ADDITIONAL INFORMATION:	

Retrofit kit 03708-60006 comprises:


- a) PROM part number 03708-80065 (A201U5)
- b) PROM part number 03708-80066 (A201U6)

### **Solution/Action**

#### **Retrofit Kit Fitting Instructions and Test**

Step 1 is only required when replacing PROM's from firmware revisions 2506 and 2510.

1. Change the test links on the A201 Microprocessor Assembly TL2,4,5 and 6 to the right hand position as shown in Figure 1.

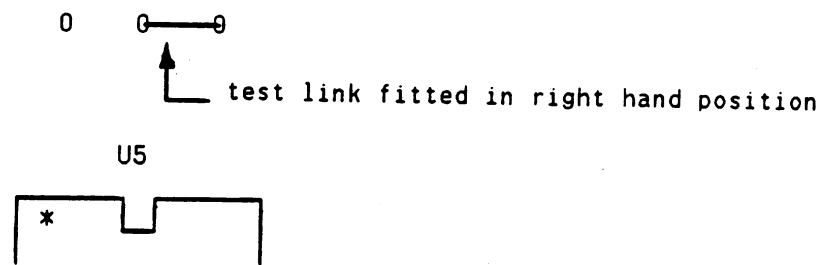

**Figure 1**

2. Fit the PROMs from the retrofit kit as follows:
  - a) 03708-80065 at location A201U5.
  - b) 03708-80066 at location A201U6.
3. Carry out Operation Verification Test 4-13 SWITCH ON and note that the 3708A front panel left hand display indicates 3603.....the new firmware revision.