

S E R V I C E N O T E

SUPERSEDES: 4352B-04

4352B VCO/PLL Analyzer

Serial Numbers: JP1KE00196 / JP1KE00207

Modification to fix a intermittent display problem**To Be Performed By:** Agilent-Qualified Personnel**Parts Required:**

P/N	Description	Quantity
E4970-66554	GSP	1

Situation:

The 4352B specified above contains the new LCD (P/N 2090- 0574) and the old GSP board (P/N E4970-66552). Sometimes this assembly configuration causes a intermittent display problem (all white image) right after the power on.

Solution / Action:

Replace from old GSP board (P/N E4970-66552) to new GSP board (P/N E4970-66554). Actually the white flat flexible cable designed for the new LCD causes the problem, however the action ws taken on the new GSP board. So don't use the new GSP board for the old LCD (P/N 2090-0534) connected to the GSP board with a brown flat flexible cable.

DATE: July 1998

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours	
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: July 2000
AUTHOR: HN	ENTITY: 3355	ADDITIONAL INFORMATION:	

