

INFORMATION ONLY – DOES NOT COMMUNICATE
A MODIFICATION OR SAFETY CONDITION

54845A-12A

S E R V I C E N O T E

Supersedes:
54845A-12

54845A Infiniium Oscilloscopes – 8Gsa/s, 4 Ch, 1.5GHZ

Serial Numbers: ALL

This Service note is communicating a possible repair strategy for instruments failing Trigger Self-Calibration. Service centers, or customers repairing Infiniium Oscilloscopes, may want to try this method previous to replacing hardware.

Parts Required:

P/N	Description	Qty.
E2610-68700	Keyboard Assembly	1

Solution/Action:

Using the keyboard press CTRL/ESCAPE, at the same time. The Start bar should appear, scroll through Programs/Windows Explorer. Using Windows Explorer, open the C:/Scope/Cal directory. There should be two files present, framecal.dat, and probecal.dat. remove both of these files. Once the two files are deleted then exit from Windows Explorer, and cycle power. Power unit on, press default setup, after 20 minute warm-up perform the user self-calibration, under the utility menu.

If scope/cal directory is not present then it may be necessary to go to View- Folder Options, and under the View tab, check show all files.

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION: INFORMATION ONLY
AUTHOR: MR PRODUCT LINE: 1A
ADDITIONAL INFORMATION: Customer Satisfaction issue.

© AGILENT TECHNOLOGIES, INC. 2002
PRINTED IN U.S.A.



September 5, 2002