

S E R V I C E N O T E

SUPERSEDES: None

66102A DC Power Supply Module**Serial Numbers:** 3421A01450 / 3421A02640**List Mode does not work from keyboard****Duplicate Service Notes:**

66101A-05: Serials 3421A01253 / 3444A02106

66102A-04: Serials 3421A01450 / 3421A02640

66103A-04: Serials 3421A01331 / 3421A02197

66104A-05: Serials 3421A00692 / 3445A01183

66105A-05: Serials 3421A00373 / 3421A00615

66106A-04: Serials 3421A00340 / 3421A00441

To Be Performed By: Agilent-Qualified Personnel or Customer**Parts Required:** 5080-2235, ROM, Rev A.00.06**Situation:**

ROM revisions A.00.04 and A.00.05 had a firmware bug that would not allow List numbers to be entered from the optional keyboard, 66001A.

Solution/Action:

Remove the cover and replace the ROM, U2 with revision A.00.06 or higher. This does not affect the alignment of the module so only operation verification is required.

DATE: January 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
MODIFICATION RECOMMENDED					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour		
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: Product's Support Life		
AUTHOR: DF	ENTITY: 2100		ADDITIONAL INFORMATION:		