

S E R V I C E N O T E

SUPERSEDES: None

66104A DC Power Supply Module**Serial Numbers:** 0000A00000 / 3421A00691**Status reported before Delay****Duplicate Service Notes:**

66101A-03: Serials 0000A00000 / 3421A01252

66102A-02: Serials 0000A00000 / 3421A01449

66103A-02: Serials 0000A00000 / 3421A01330

66104A-03: Serials 0000A00000 / 3421A00691

66105A-03: Serials 0000A00000 / 3421A00372

66106A-02: Serials 0000A00000 / 3421A00339

To Be Performed By: Agilent-Qualified Personnel or Customer**Parts Required:** 5080-2235, ROM, Rev A.00.06**Situation:**

ROM revisions A.00.03 and before had a firmware bug that would sometimes allow the Status to be reported before the Delay time ran down. This situation would occur about 1% to 3% of the time.

Solution/Action:

Remove the cover and replace the ROM, U2 with revision A.00.06 or higher. This does not affect the alignment of the module so only operation verification is required.

DATE: January 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
MODIFICATION RECOMMENDED					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour		
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: Product's Support Life		
AUTHOR: DF	ENTITY: 2100	ADDITIONAL INFORMATION:			