

S E R V I C E N O T E

SUPERSEDES: None

**66104A DC Power Supply Module**

**Serial Numbers:** 3421A00692 / 3445A01183

**List Mode does not work from keyboard**

**Duplicate Service Notes:**

- 66101A-05: Serials 3421A01253 / 3444A02106
- 66102A-04: Serials 3421A01450 / 3421A02640
- 66103A-04: Serials 3421A01331 / 3421A02197
- 66104A-05: Serials 3421A00692 / 3445A01183
- 66105A-05: Serials 3421A00373 / 3421A00615
- 66106A-04: Serials 3421A00340 / 3421A00441

**To Be Performed By:** Agilent-Qualified Personnel or Customer

**Parts Required:** 5080-2235, ROM, Rev A.00.06

**Situation:**

ROM revisions A.00.04 and A.00.05 had a firmware bug that would not allow List numbers to be entered from the optional keyboard, 66001A.

**Solution/Action:**

Remove the cover and replace the ROM, U2 with revision A.00.06 or higher. This does not affect the alignment of the module so only operation verification is required.

DATE: January 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
<b>MODIFICATION RECOMMENDED</b>			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: DF	ENTITY: 2100	AGILENT RESPONSIBLE UNTIL: Product's Support Life	
		ADDITIONAL INFORMATION:	

