

S E R V I C E N O T E

SUPERSEDES: None

66106A DC Power Supply Module

Serial Numbers: 0000A00000 / 3421A00339

Status reported before Delay

Duplicate Service Notes:

- 66101A-03: Serials 0000A00000 / 3421A01252
- 66102A-02: Serials 0000A00000 / 3421A01449
- 66103A-02: Serials 0000A00000 / 3421A01330
- 66104A-03: Serials 0000A00000 / 3421A00691
- 66105A-03: Serials 0000A00000 / 3421A00372
- 66106A-02: Serials 0000A00000 / 3421A00339

To Be Performed By: Agilent-Qualified Personnel or Customer

Parts Required: 5080-2235, ROM, Rev A.00.06

Situation:

ROM revisions A.00.03 and before had a firmware bug that would sometimes allow the Status to be reported before the Delay time ran down. This situation would occur about 1% to 3% of the time.

Solution/Action:

Remove the cover and replace the ROM, U2 with revision A.00.06 or higher. This does not affect the alignment of the module so only operation verification is required.

DATE: January 1996

ADMINISTRATIVE INFORMATION

| | | | |
|---------------------------------|--|---|---|
| SERVICE NOTE CLASSIFICATION: | | | |
| MODIFICATION RECOMMENDED | | | |
| ACTION CATEGORY: | <input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME | STANDARDS: | Labor 0.5 Hour |
| LOCATION CATEGORY: | <input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER | SERVICE INVENTORY: | <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT |
| AVAILABILITY: | PRODUCT'S SUPPORT LIFE | USED PARTS: | <input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT |
| AUTHOR: DF | ENTITY: 2100 | AGILENT RESPONSIBLE UNTIL: Product's Support Life | |
| | | ADDITIONAL INFORMATION: | |

