

S E R V I C E N O T E

SUPERSEDES: NONE

66319B Mobile Communications DC Source

Serial Numbers: See Duplicate Service Notes

Fetch:Current? Error 603

Duplicate Service Notes:

66319B-02 Serials 0000A00000 / US40170201
 66319D-02 Serials US00000000 / US40180416
 66321B-02 Serials US00000000 / US40170145
 66321D-02 Serials US00000000 / US40180120

To Be Performed By:Agilent-Qualified Personnel

Parts Required:5182-9091; Rev A.02.07

Situation:

Error 603 is given when a "FETCH: CURR?" is sent over the bus, while in the 1-AMP Current Range.

Solution / Action:

Replace the Firmware ROM U205 on the A2 GPIB board and perform a "ROM UPDATE" from the front panel of the unit. Re-calibration is not necessary if only a ROM UPDATE is performed.

DATE: June 2001

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR 0.5 Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: BM	ENTITY: 2100	AGILENT RESPONSIBLE UNTIL: June 2003	
		ADDITIONAL INFORMATION:	

