S E R V I C E N O T E

SUPERSEDES: None

83480A Digital Communications Analyzer

Serial Numbers: 0000A00000 / 9999Z99999

Plug-in vertical calibration failures on 83480A option 100 mainframes

Duplicate Service Notes: 54750A-01

To Be Performed By: Agilent-Qualified Personnel

Situation:

If option 100 is installed in the mainframe, the plug-in vertical calibration will fail if the enhanced trigger mode is selected.

Solution / Action:

Before attempting the plug-in vertical calibration (Utility/Calibrate Calibrate plug-in..../select plug-in and start cal), Select Trigger/ Trig Bandwidth/DC - 2.5 GHz. The vertical calibration will fail if trigger bandwidth 2 - 12 GHz or 2 - 12 GHz Gate is selected. This does not mean there is a problem with the plug-in module.

DATE: March 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
	INFORMAT	TION ONLY
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
ВН	5360	

© 1999 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

