S E R V I C E N O T E

SUPERSEDES: 8560A-28

HP 8560A Portable Spectrum Analyzer

Serial Numbers:

8560A-28A: 3146A01932/3413A02687 8560E-06A: 0000A00000/3425A01033 8561E-05A: 0000A00000/3425A00723 8562A-68A: 3148A06894/3337A07664 8563A-21A: 3146A00562/3413A02911 8563E-07A: 0000A00000/3425A00476 8564E-08: 0000A00000/3425A00182 8565E-08: 0000A00000/3425A00183 **Duplicate Service Notes:** See Above

Modification to improve focus reliability

Parts Required:

HP P/N	Description	Quantity
0160-6420	0.0047uf Capacitor	2
1901-1214	Diode, 600V	2

Continued

DATE: August 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION AVAILABLE			
ACTION CATEGORY:	AGREEABLE TIME	☐ PERFORMANCE ENHANCEMENT ■ SERVICE/RELIABILITY ENHANCEMENT	
LOCATION CATEGORY:	■ CUSTOMER INSTALLABLE □ ON-SITE ■ HP LOCATION	AVAILABLE UNTIL: Life of Product	
AUTHOR: GPB	ENTITY: 5300	ADDITIONAL INFORMATION:	

© 1996 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Page 2 Service Note 8560A-28A

Situation:

The breakdown voltage of two diodes used on the A17 CRT Driver assembly can be exceeded. A possibility exists that, if this voltage is exceeded, the diode may be damaged and focus will be degraded. Using diodes with a higher breakdown voltage will improve focus reliability. Changing the dides alone, however, can cause the intensity at low levels to flicker.

Solution/Action:

Replace A17CR10 and A17CR30 with HP part number 1901-1214. Also replace A17C11 and A17C30 with 0.0047uf capacitors, part number 0160-6420.