

S E R V I C E N O T E

SUPERSEDES: NONE

8662A Synthesized Signal Generator

Serial Numbers: 0000A00000 / 9999Z99999

Procedure to resolve A7A4 (08662-60376) C2 and C3 leakage

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N	Description	Quantity
0180-2835	600uf 200V Capacitor	1

Situation:

The 600uf 200V Capacitors (A7A4C2 and A7A4C2) part number 0180-2835 manufacturing by PHILIPS with date code 96XX may have internally leakage. When this occurs, it will load down the ± 110 Vdc switch drivers.

Solution / Action:

Order the replacement capacitor (0180-2835). Replace the part and recalibrate the 8662A Synthesized Signal Generator. All 0180-2835 PHILIPS' with date code 96XX have been purged from inventory.

DATE: March

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input type="checkbox"/> ON SPECIFIED FAILURE <input checked="" type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR 0.5 Hours
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
		USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: April 2001	
AUTHOR: SN	ENTITY: 5320	ADDITIONAL INFORMATION:	

