

S E R V I C E N O T E

SUPERSEDES: None

89430A RF Section

Serial Numbers: 0000A00000 / 3337A00270

Sharp Metal Edge Shorting Power Supply Cable**To Be Performed By:** Agilent-Qualified Personnel**Duplicate Service Notes:** None**Parts Required:**

Part No.	Description
0890-0025	Plastic Tubing

Situation:

The insulation on a wire in a bundle of cables may be damaged by a sharp metal edge resulting in a power supply short.

Solution/Action:

Perform the following steps to place a plastic tubing over bundle of cables at the sharp metal edge location.

STEP 1: Remove the bottom cover.

STEP 2: Place the spiral plastic tubing over the bundle of cables which cross the A99 Motherboard and the sheet metal bracket MP111. See Figure 1.


Continued

DATE: 05 May 1994

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input type="checkbox"/> ON SPECIFIED FAILURE <input checked="" type="checkbox"/> AGREEABLE TIME	STANDARDS: Labor 0.5 Hour	
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT	USED PARTS: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: 05 May 1996
AUTHOR: CMG	ENTITY: A100	ADDITIONAL INFORMATION:	

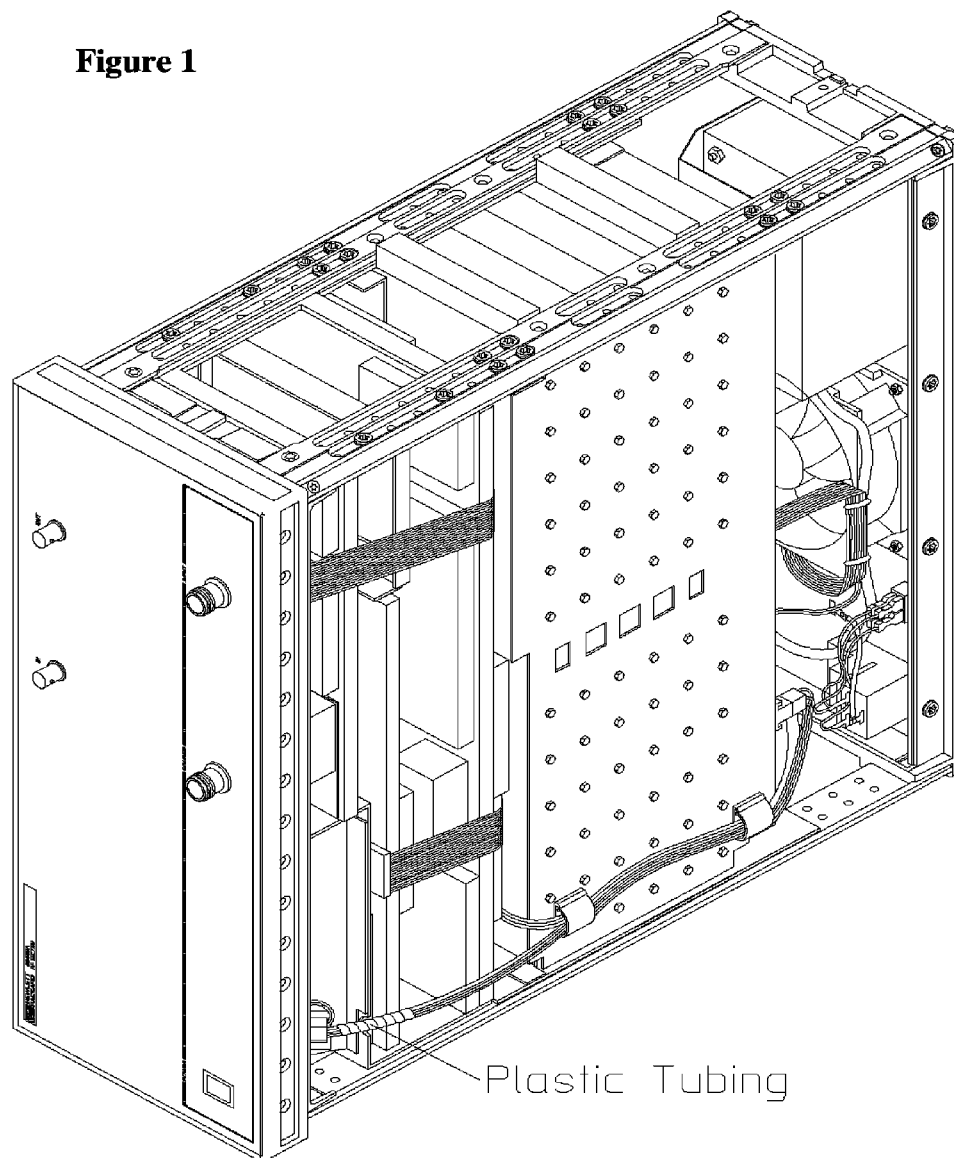

Figure 1

If any of the cables are damaged, see chapter 7, “Replacing Parts” in the 89440A Service Guide for replacement information.