

## S E R V I C E N O T E

SUPERSEDES: None

**89430A RF Section****Serial Numbers:** 0000A00000/9999Z99999**Changes to troubleshooting procedures****Situation:**

Several of the troubleshooting procedures in the 89430A service guide depend on the instrument setup used after pressing the service function preset softkey. With version A.05.00 through A.06.00 firmware the frequency is set to 901 MHz instead of 5 MHz.

**Solution/Action:**

Anytime the troubleshooting procedure calls for key presses [service functions], [special test modes], [RF section], [PRESET], verify that the LO frequency (softkey F5) is set to 5 before continuing with the procedure.

DATE: March 1999

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

**INFORMATION ONLY**

AUTHOR:

DWH

ENTITY:

A100

ADDITIONAL INFORMATION:

