

DSAV134A-02A

Modification Recommended Service Note

Supersedes:
DSAV134A-02

DSAV134A Infiniium Oscilloscope: 13GHz

Serial Numbers: MY00000000 / MY55300101

[The Problem – V-series scopes can shut down after the initial power on.

Parts Required:

P/N	Description	Qty.
-----	-------------	------

NONE

ADMINISTRATIVE INFORMATION

ACTION	☐	ON SPECIFIED FAILURE	STANDARDS					
CATEGORY:	X	AGREEABLE TIME	LABOR: 1.0 Hours					
LOCATION	☐	CUSTOMER INSTALLABLE						
CATEGORY:	☐	ON-SITE (active On-site contract required)	SERVICE:	☐	RETURN	USED	☐	RETURN
	X	SERVICE CENTER	INVENTORY:	☐	SCRAP	PARTS:	☐	SCRAP
	☐	CHANNEL PARTNERS		☐	SEE TEXT		X	SEE TEXT
AVAILABILITY: PRODUCT'S SUPPORT LIFE			NO CHARGE AVAILABLE UNTIL: DEC. 01 2019					
	X	Calibration Required	PRODUCT LINE PL1A					
	☐	Calibration NOT Required	AUTHOR: MRR					

ADDITIONAL INFORMATION: This action "RTF" should be taken on any failure of the listed serial numbers in effect.

Situation:

V-series scopes can shut down after the initial power on. Units that were originally manufactured had a component on the acquisition assembly loaded that should have not been loaded. The component is L305 and needs to be removed on both acquisition assemblies. V-Series units effected need to be Returned To the Factory for upgrade, please see serial numbers to determine if RTF process is required.

Solution/Action:

– V-series scopes that have serial numbers < MY55300102 if returned to local service centers for repair need to be transshipped to F03 for factory repair.

The factory will remove the L305 and test, calibrate unit to specifications return with Certificate of Calibration.

Revision History:

Date	Service Note Revision	Author	Reason for Change
27 June 2018	01	Mark Rowley	As Published