# S E R V I C E N O T E

SUPERSEDES: None

#### **HP E4240B RTA Protocol Tester**

Serial Numbers: See Text

# **Duplicate Service Notes:**

E4093B-01 E4095B-01 E3910B-01 E3939B-01

# Fan speed regulator no longer required

To Be Performed By: HP-Qualified Personnel

#### Parts Required:

5063-3507 Cooling Fan Serials 05-0000/CA33150048 Assembly

#### Situation:

Cooling fans used in current production incorporate a temperature sensing speed control, which was previously discrete circuitry. When a new fan is used to replace an older fan, the discrete speed control circuitry is redundant and should be disabled.

Continued

DATE: 17 November 1993

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICAT	FION:	
INFORMATION ONLY		
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
HS	Z600	

© 1993 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Page 2 Service Note E4240B-01

#### Solution/Action:

1) Cut all leads on REG301 and desolder from backplane. Clear holes of any solder or debris.

- 2) Solder a jumper between pin 2 and pin 3 of REG301. Ensure that the leads of the jumper are short enough to avoid shorts.
- 3) Install new fan assembly, re-using grille from old assembly. Make sure that spacers provided with new fan assembly are used, to avoid breaking the fan housing.
- 4) Plug fan into the same 4 pin connector (P301) as the old fan used.