

MODIFICATION RECOMMENDED

**E5061B-02**

**S E R V I C E N O T E**

Supersedes:  
NONE

"E5061B Network Analyzer, 5 Hz to 3GHz"

Serial Numbers: "MY49100101 - MY49100168"

**A screw for heat sink of CPU board might become loosened.**

**Parts Required:**

P/N	Description	Qty.
NONE		
or		
E5061-69050	Tested CPU Exchange	1

**ADMINISTRATIVE INFORMATION**

SERVICE NOTE CLASSIFICATION:			
<b>MODIFICATION RECOMMENDED</b>			
ACTION CATEGORY:	<input type="checkbox"/> ON SPECIFIED FAILURE <input checked="" type="checkbox"/> AGREEABLE TIME	STANDARDS	LABOR: 0.75 Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input checked="" type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER <input type="checkbox"/> CHANNEL PARTNER	SERVICE INVENTORY: <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS: <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 2012 May	
AUTHOR:	jm	PRODUCT LINE: WN	
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2010  
PRINTED IN U.S.A.

April 21, 2010  
Rev. 17



**Situation:**

A screw for heat sink of CPU board might be loosened or removed, due to wrong screw position.


**Solution/Action:**

Step-1. Check that all four screws are NOT removed.

In case a screw is removed, find the screw in the box, to prevent circuit short out.

When the screw is found, go to Step-2.



When the screw is not found, replace the CPU board.

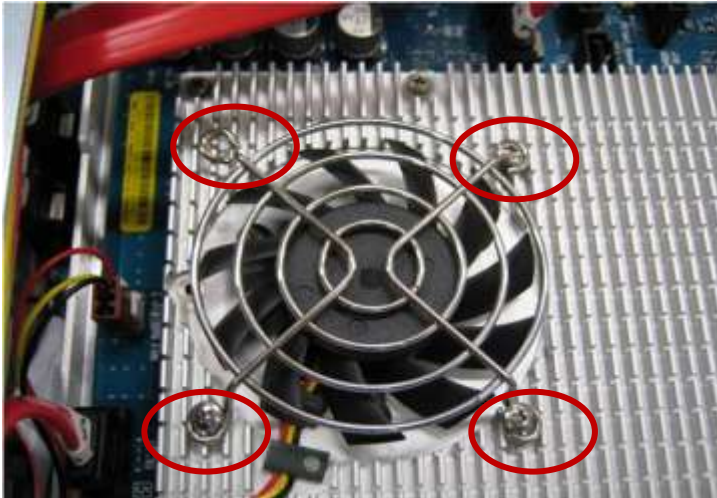

Step-2. Check the positions of all the four screws.

Right Position

Wrong Position

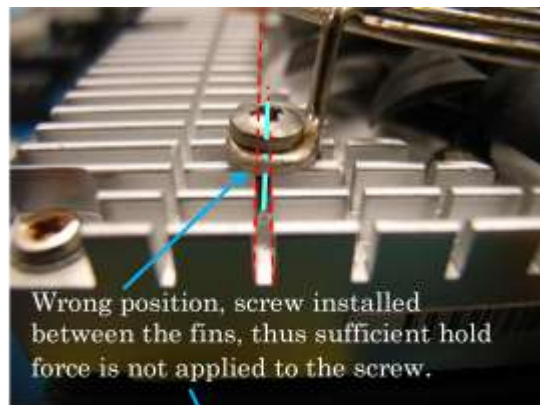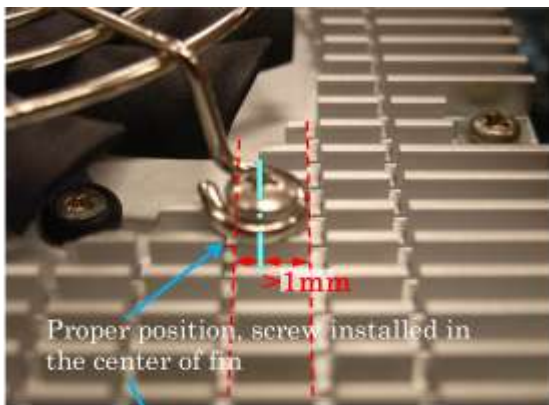

Top view



In case of Wrong position of the screw, remove the wrong position screw and tighten the screw with Right position.