M9502A-04-S

SERVICE NOTE

Supersedes: NONE

M9502A AXIe 2 Slot Chassis

Affected Serial Numbers Range: TW00000000 through TW53140257

Exceptions: TW52351304, TW52351310, TW52421301, TW52421303, TW52421304, TW52431301 through TW52431310, TW52470303, TW53030309, TW53040302, TW53140101 through TW53140108, TW53140238, TW53140241, TW53140242, TW53140243, TW53140246, TW53140247, TW53140249, TW53140255, and TW53140256

WARNING HAZARD CLASS 1

Chassis carry handle may come off while handling

Parts Required:

P/N Description Qty.

M9502-80001 M9502A and M9505A Handle Screw Kit 1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:				
SAFETY				
ACTION CATEGORY: √ AGREEABLE TIME	STANDARDS LABOR: 0.5 Hours			
LOCATION √ CUSTOMER INSTALLABLE CATEGORY: [[]] ON-SITE (active On-site contract required) √ SERVICE CENTER [[]] CHANNEL PARTNER	SERVICE √ RETURN INVENTORY: [[]] SCRAP [[]] SEE TEXT	USED [[]] RETURN PARTS: √ SCRAP [[]] SEE TEXT		
AVAILABILITY: ALWAYS	NO CHARGE AVAILABLE UNTIL: EOS			
[[]] Calibration Required √ Calibration NOT Required	PRODUCT LINE: BL AUTHOR: TP			
ADDITIONAL INFORMATION:				

© AGILENT TECHNOLOGIES, INC. 2013 PRINTED IN U.S.A.



Page 1 of 2

September 19, 2013

Rev. 23

Page 2 of 2 M9502A-04-S

Situation:


Chassis carry handle screws may become loose over time causing the carry handle to come off while handling.

Solution/Action:

Carry handle screws with locking mechanism will prevent this issue. Picture below shows the screw with locking mechanism included in the M9502A and M9505A Handle Screw Kit (M9502-80001).



Replace the screws on the chassis carry handle shown in the picture below. Use 8.7 to 10 in-lbs torque to tighten the screws.

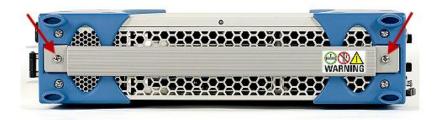

Revision History:

Revision Number	Date	Author	Reason For Change
1.0	9/18/13	Tran Pham	As published