

4981A-11

S E R V I C E N O T E

SUPERSEDES: None

HP 4981A Network Advisor

Serial Numbers: 0000A00000 / 9999A99999

Duplicate Service Notes:

- J2213A-03
- J2219A-02
- 4980A-11
- 4982A-11

Monochrome LED Board Modification (NOT Color)

J2176-66502 LED Board Assembly

Situation:

When new monochrome assembly 5063-1880 is required to replace the older 5062-9677 display, the LED board must be modified. The modification will allow a greater range of brightness adjustment.

Solution:

1. Remove fastener(s)
2. Disconnect jumper wires

Continued


DATE: 16 November 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
<b>MODIFICATION RECOMMENDED</b>					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR: 1.0 Hour		
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> HP LOCATION	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	RESPONSIBLE UNTIL : 16 november 1995			
AUTHOR: NB	ENTITY: 3800	ADDITIONAL INFORMATION:			



3. Carefully snap out LED display board assembly
4. Locate jumper and remove at one of either location as shown in the diagram

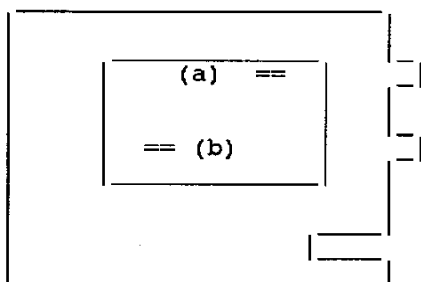

Jumper locations  
(a) or (b) is on  
the small board.

5. Reinstall wires/fasteners and board assembly
6. Test brightness operation