

S E R V I C E N O T E

SUPERSEDES: NONE

54121A Four Channel Test Set**Serial Numbers:** 0000A00000 / 2926A99999**New heatsink required when horizontal board assembly is changed****Duplicate Service Notes:** None**To Be Performed By:** Agilent-Qualified Personnel**Situation:**

A new heatsink MP12 and two new mounting screws are needed when the A1 Horizontal Board Assembly is changed. See Parts Required below.

The three terminal regulator A1U26 is now soldered directly into the board assembly which eliminates the regulator socket. This new mounting arrangement requires the new MP12 heatsink that has two tapped holes for mounting. See Figure 1.

Parts Required:**Required Parts for replacing A1 Horizontal Board Assembly**

Part No.	Qty.	Description
54120-21103	1	Heatsink
0515-03722	2	Screw-Machine M3 X 0.5 8MM-Lg

Continued

DATE: 31 October 1991

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
RK	0800	

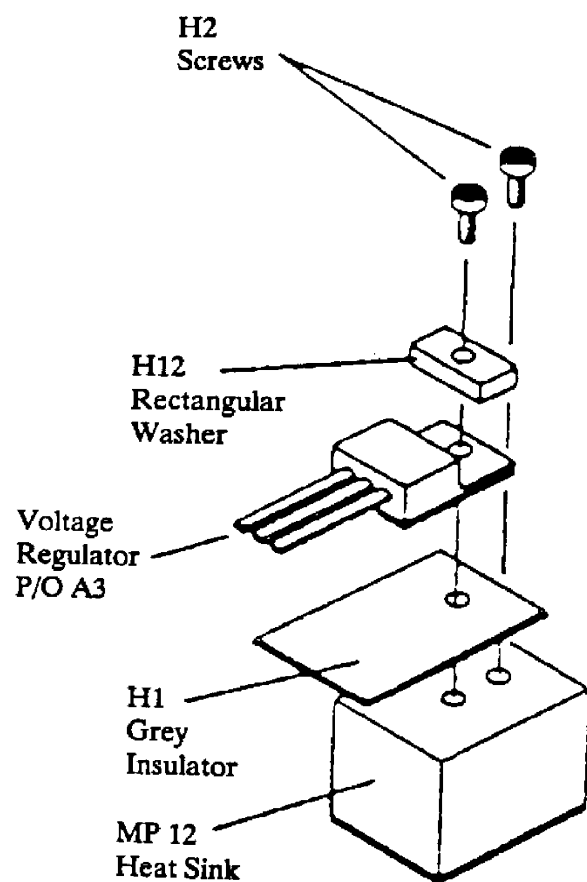


Figure 1. New Heatsink Mounting Arrangement