

MODIFICATION RECOMMENDED

N1922A-01A

S E R V I C E N O T E

Supersedes:
N1922A-01

Agilent P-series Wideband Power Sensor

Serial Numbers: US00000001 / US99999999

Loose bulkhead (N1920-60005)

Parts Required:

P/N	Description	Qty.
NONE		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS	LABOR: 0.4 Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER <input type="checkbox"/> CHANNEL PARTNER	SERVICE INVENTORY: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP X SEE TEXT	USED PARTS: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP X SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 18-June-08	
AUTHOR:	CH	PRODUCT LINE: WC	
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2008
PRINTED IN U.S.A.

June 17, 2008

Rev. 15



Situation:

Loose bulkhead (p/n: N1920-60005) for P-series wideband power sensor built in US. Kindly send it to local service center for rework.

Solution/Action:


1. Screw lock nut 85025-20003 onto threaded end of bulkhead assembly. Apply loctite (0427-0231) on the first, second and third threads of the end of the bulkhead (as shown in the figure below):



2. Torque lock nut to 28 in. -lbs. with T-314592.



T-314592

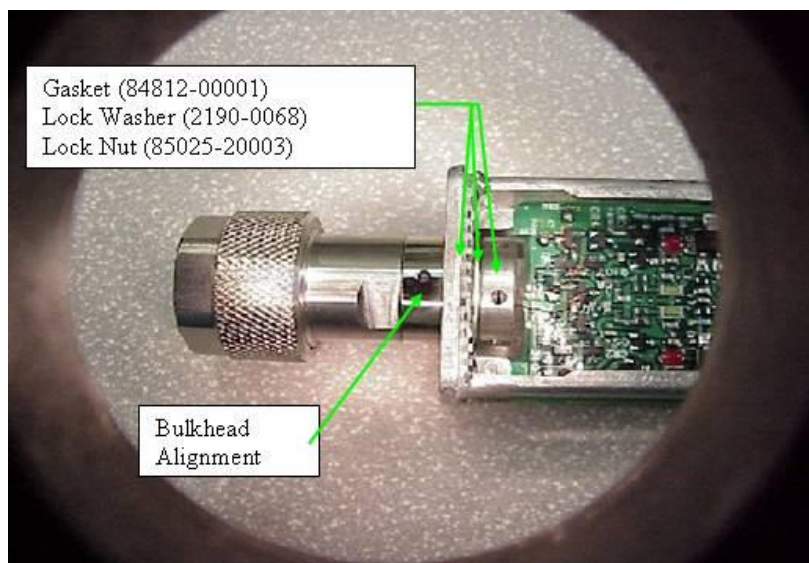

3. Calibrate the unit after the above changes are applied.